TECHNICAL INFORMATION

Marsclay Light L3 8432LC



Composition: waxes, oil, fillers (sulfur-free), pigments

Density: approx. 0,9 g/cm³, de-aired

Color: brown Odor: neutral

 α (Linear Shrinkage Coefficient) constant 1,7 x 10⁻⁴ K⁻¹ (0 – 20°C / 32 – 68°F)

Ø 2,1 x 10^{-4} K⁻¹ $(20 - 35^{\circ}$ C / $68 - 95^{\circ}$ F) constant 2,6 x 10^{-4} K⁻¹ $(35 - 60^{\circ}$ C / $95 - 140^{\circ}$ F)

Shelf life: at least 24 months at temperatures from 0°C/32°F to 30°C/86°F

maximum 14 days in the oven at 55°C/131°F - 60°C/140°F

Working temperature: 55°C/131°F - 60°C/140°F

Degree of hardness: medium

Shore hardness A: 64 (20°C/68°F)

STAEDTLER-hardness AH / g: 23°C/73,4°F: 5.500 40°C/104°F: 900 60°C/140°F: 350

Solubility: insoluble in water, partially soluble in organic solvents

Toxicology: Marsclay Light is toxicologically harmless,

certified by ACMI, USA.

Sales information: 1 twin round bar = 1,30 kg/2,87 lbs; volume: approx.1,45 l


(2 bars each diameter approx. 6,0 cm; length of bar approx. 26 cm)

9 pcs in carton; 216 pcs on pallet

The values given are typical test results which should be used as a guide only. They cannot be considered as specifications or quarantees.

Cooling rate of Marsclay Light Hardness-Temperature-Diagram

 Cooling rate of Marsclay Light Hardness-Time-Diagram Cooling behaviour to 23°C/74°F

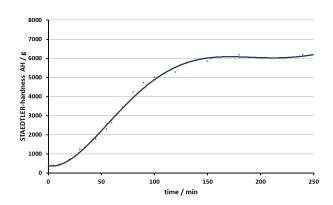

SIP-V2/01-2025 Page 1 / 2



Safety instruction:

- Do not heat **Marsclay Light** over the recommended temperature (60°C / 140°F). Hazards:
 - Burns to the skin from molten material
 - The material can be ignited at higher temperatures; the following instructions should therefore be followed:
 - Keep well away from ignition sources
 - Prevent contact with uncovered heating wires/heating coils
 - Keep well away from sparks/open flames
- Do not use any combustible materials when heating the material in the oven.
- Safety data sheets are obtainable on request.

Instruction of use:

- As a permanently malleable compound Marsclay Light remains pliable and can be used again and again.
- When heated to 55°C/131°F 60°C/140°F, the clay becomes soft and pliable.
- The heating period is about 5 hours (depending on type and loading of oven).
- At room-temperature up to 25°C/77°F the models keep their contours and edges.
- By hot conditions or direct solar radiation softening of the surface occurs.
- Wood, polystyrene and hard foams can be used as base materials.
- Base materials and the warm modelling clay bond without the need of adhesives.
- Grave quantities should be applied in layers.
- By applying of bigger masses, we commend to warm up the base layer for an optimum bond.
- Once the top surface has cooled down, the model can be shaped by hand or milling machines.
- Modifications can be made to the finished model simply and dust free.
- Due to the special bonding qualities small amounts of material can be applied.
- In case of serious changes, the roughening of the previous surface is recommended.
- Finishes with modelling film can be removed quickly and easily.
- When using a heat-gun do not exceed temperatures above 60°C/140°F.
- The clay-model can be casted with gypsum or silicone. As releasing agent shellac can be used.
- The clay can be lacquered with **ClayPeel**.
- Soiled surfaces can be cleaned with solvent cleaner.

STAEDTLER Industrial Products GmbH, Moosaeckerstr. 3, 90427 Nuernberg, Germany, Tel. +49(0)911 9365-0, service.de@staedtler.com www.industrial-products.com

SIP-V2/01-2025 Page 2 / 2